

# Manhole Inspection Summary

Manhole # S06SS1008MH

Printed On: 6/24/2010

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **06SS1** Node: **008** Status: **Found**

Insp Date: **12/4/07 10:15 AM**

Incomplete Comments

Crew: **TJ, BC**  
Inspector: **Johnson**  
Firm: **URS**

**Location** Address: **6516VINCENNES AVE**

Cross Street: **PATTERNSON AVE**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **4** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **8** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View



CHIMNEY

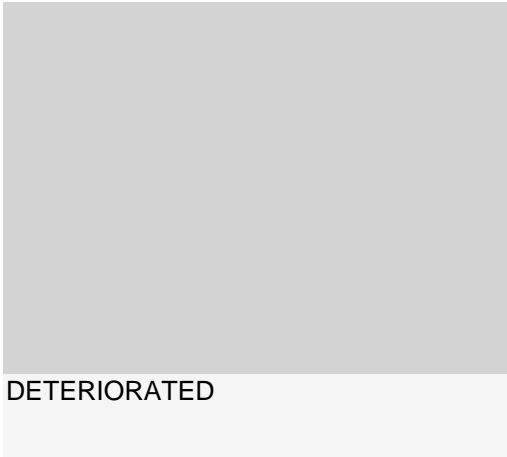

OFFSET



DETERIORATED

## Manhole Inspection Summary

Manhole # S06SS1008MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.52** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.74** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** **Rod and Bar**  
Angled: **Yes** Reading: **14.00** (ft.)  
Inv Depth: **15.00** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection